

Radon Inspection Report

Test Location:

Test For:

Inspected By:

Tim Reed
108 Thornwood Drive
Woodstock, GEORGIA 30188
770-905-9305
Lic/Cert. # 251478



Test Result: Pass

Overall Average:

3.2 pCi/l

Test Device Details:

Serial Number: 300001197
Model Number: 1028XP
Last Calibration: 07/13/2024
Next Calibration: 07/13/2025
Cal-Factors: 2.70
Motion Error: No

Test Site Condition:

Condition: Raining
Structure Type: Finished basement
Year Built: 2014
Sq Ft: 9610

Test Summary:

<u>CRM Location:</u>	<u>Start:</u>	<u>Stop:</u>	<u>Interval:</u>	<u>Duration:</u>
Finished basement	09/12/2024 02:07 PM	09/14/2024 12:07 PM	1 hr	46 hr
	<u>Min:</u>	<u>Max:</u>	<u>Average:</u>	<u>Measurement Units:</u>
Radon Concentration:	0.0	6.3	3.2	pCi/l


Comments:

Thank you for allowing us to perform your radon test. During this process we took great care to ensure the accuracy of the results.

Lic/Cert Signature

Inspection Report Date: 09/14/2024

Radon Inspection Chart

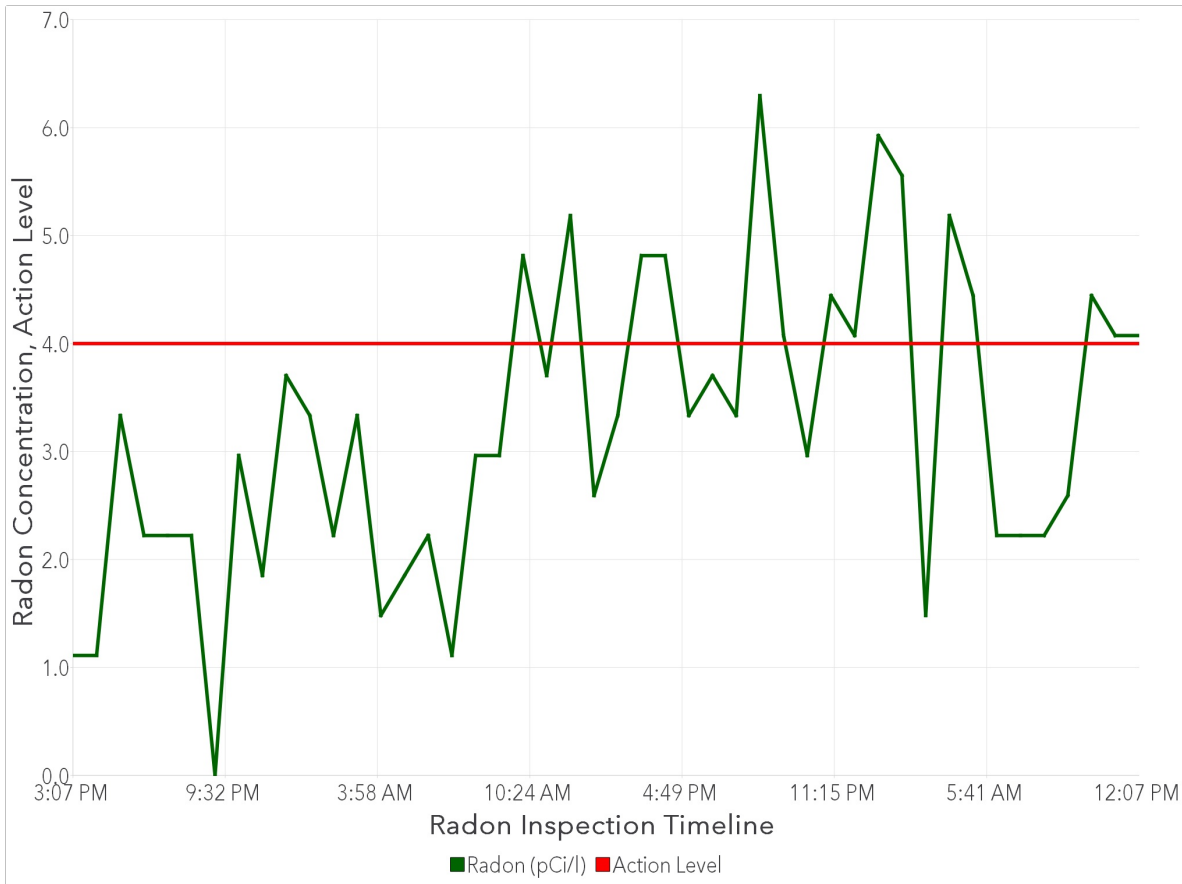

Test Result: Pass

Test Location: 1404 Ragley Hall Road Brookhaven, GEORGIA 30319

Inspection Report Date: 09/14/2024

Test device manufactured by SunRADON, LLC

Test Checklist

- The location of the detector was selected so the detector was not to be disturbed during testing.
- The monitor was not placed in an area of high humidity such as: Kitchen, laundry room, cellar, spa room, garage, crawl space or sump area.
- The detector was not located near drafts caused by HVAC vents, windows and doors.
- Whole house fans were turned off during the testing.
- The detector was not placed near areas of excessive heat, such as a fireplace or in direct sunlight.
- Portable window fans were removed or sealed in place prior to testing.
- The detector was placed within the breathing zone of at least 20 inches to 6 feet above the floor and at least 1 foot below the ceiling if suspended.
- Window air conditioners were operable in recirculation mode only.
- The detector was not placed within 1 foot of outside walls of the home or within 3 feet of any windows or doors to the exterior of the home.
- Ceiling fans, portable dehumidifiers, portable humidifiers, portable air filters, and all window air conditioners are not operated within 20 feet of the detector.

Test Result: Pass

Test Location: 1404 Ragley Hall Road Brookhaven, GEORGIA 30319

Inspection Report Date: 09/14/2024

Test device manufactured by SunRADON, LLC



Test Table

<u>Date/Time</u>	<u>Radon(pCi/l)</u>	<u>Flags</u>
09/12/24 03:07 PM	1.1	-
09/12/24 04:07 PM	1.1	-
09/12/24 05:07 PM	3.3	-
09/12/24 06:07 PM	2.2	-
09/12/24 07:07 PM	2.2	-
09/12/24 08:07 PM	2.2	-
09/12/24 09:07 PM	0.0	-
09/12/24 10:07 PM	3.0	-
09/12/24 11:07 PM	1.9	-
09/13/24 12:07 AM	3.7	-
09/13/24 01:07 AM	3.3	-
09/13/24 02:07 AM	2.2	-
09/13/24 03:07 AM	3.3	-
09/13/24 04:07 AM	1.5	-
09/13/24 05:07 AM	1.9	-
09/13/24 06:07 AM	2.2	-
09/13/24 07:07 AM	1.1	-
09/13/24 08:07 AM	3.0	-
09/13/24 09:07 AM	3.0	-
09/13/24 10:07 AM	4.8	-
09/13/24 11:07 AM	3.7	-
09/13/24 12:07 PM	5.2	-
09/13/24 01:07 PM	2.6	-
09/13/24 02:07 PM	3.3	-
09/13/24 03:07 PM	4.8	-
09/13/24 04:07 PM	4.8	-
09/13/24 05:07 PM	3.3	-
09/13/24 06:07 PM	3.7	-
09/13/24 07:07 PM	3.3	-
09/13/24 08:07 PM	6.3	-
09/13/24 09:07 PM	4.1	-
09/13/24 10:07 PM	3.0	-
09/13/24 11:07 PM	4.4	-
09/14/24 12:07 AM	4.1	-
09/14/24 01:07 AM	5.9	-
09/14/24 02:07 AM	5.6	-
09/14/24 03:07 AM	1.5	-
09/14/24 04:07 AM	5.2	-
09/14/24 05:07 AM	4.4	-
09/14/24 06:07 AM	2.2	-
09/14/24 07:07 AM	2.2	-
09/14/24 08:07 AM	2.2	-
09/14/24 09:07 AM	2.6	-
09/14/24 10:07 AM	4.4	-

Test Result: Pass

Test Location: 1404 Ragley Hall Road Brookhaven, GEORGIA 30319

Inspection Report Date: 09/14/2024

Test device manufactured by SunRADON, LLC



Open Eye Home Inspections
108 Thornwood Drive
Woodstock, GEORGIA 30188
770-905-9305

Test Table

<u>Date/Time</u>	<u>Radon(pCi/l)</u>	<u>Flags</u>
09/14/24 11:07 AM	4.1	-
09/14/24 12:07 PM	4.1	-

Test Result: Pass

Test Location: 1404 Ragley Hall Road Brookhaven, GEORGIA 30319

Inspection Report Date: 09/14/2024

Test device manufactured by SunRADON, LLC

Radon Test Information

Radon Risk Information

Radon causes lung cancer by means of the decay of its daughter products after breathing in air contaminated with higher levels of Radon. The World Health Organization (WHO) estimates that 15% of lung cancers worldwide are caused by exposure to elevated indoor levels of Radon. Overall, radon is the second leading cause of lung cancer responsible for about 21,000 lung cancer deaths every year in the US alone. Radon gas is the number one cause of lung cancer among non-smokers. The U.S. Environmental Protection Agency (EPA), the U.S. Surgeon General, and the Center for Disease Control and Prevention (CDC) strongly recommend that ALL homebuyers have an indoor radon test performed prior to purchase or taking occupancy and recommend having the radon levels professionally mitigated if elevated radon concentrations are found.

Understanding Radon Test Results

Recommended Action Levels vary by country and typically range from 3 pCi/l (100 Bq/m³) to 8 pCi/l (300 Bq/m³). Recommendations below are based on test results by a Continuous Radon Monitor (CRM) Test of at least 48h duration and are based on recommendations by the EPA.

Measured Average Radon Level:

- At or above 4.0 pCi/l (148 Bq/m³): Corrective measures to reduce exposure to radon gas is strongly recommended (ANSI MAH2014)
- Between 2-4 pCi/l (74-148 Bq/m³): Consider mitigation or periodic retest as indoor Radon levels vary by season and weather conditions
- Below 2 pCi/l (74 Bq/m³): Consider bi-annual retest or whenever significant changes to the home structure or mechanical systems occurred

Test Result: Pass

Test Location: 1404 Ragley Hall Road Brookhaven, GEORGIA 30319

Inspection Report Date: 09/14/2024

Test device manufactured by SunRADON, LLC